SAFETY INSPECTION REPORT

CONDUCTED FOR: West Builders, Inc.

PROJECT: Fullerton HUB



INSPECTION TYPE: General Construction

INSPECTOR : JASON CHAVEZ DATE : SEPTEMBER 05, 2024 CITY : FULLERTON STATE : CA

Safety Compliance Company is not responsible for unsafe conditions and situations not seen during this inspection. The items listed above represent only what was seen by the Safety Compliance Company Representative at the time of the inspection. Safety Compliance Company is not responsible for any ongoing unsafe condition(s) whether seen or unseen. In addition, Safety Compliance Company does not have the authority or authorization to approve, certify, or warranty any safety equipment or safety device. This agreement also indemnifies Safety Compliance Company of any omission, gross negligence, willful misconduct related to this report. Under Federal, State and Local Law, it is the responsibility of the employer and all subcontractors to mark all hazards with appropriate signs

SUMMARY OF INSPECTION			
53	37	7	9
Items Inspected	Satisfactory	Unsatisfactory	N/A

The site was visited for a safety inspection. The contractors on site were observed regarding items including PPE, tools, and equipment and safe practices. Items of concern are noted in this report. The observations were discussed with the project team.

Contractors Onsite: Tinco Trademark Guy Yocom Rye AmPam Lighthouse Glass Sharpe Atlas Triton J&S

Site Specific Activity:

Note, all trades accessing the scaffold must have a daily inspection of the scaffold. The competent person must make any corrections prior to work commencing.

Trades are engaged in rough in of plumbing and electrical. Wood and metal framing activities are in process. Insulations, drywall hanging, mudding and taping. Straight edge work by framing.

INSPECTION ITEMS

Documentation	
Site Contact	Satisfactory
Comment	
Project Management Team	-
Safety Program (Including IIPP)	Satisfactory

Comment	
IIPP is available onsite.	-
Heat Illness Prevention Program	Satisfactory
Safety Data Sheets	Satisfactory
Daily Inspections	Satisfactory
Tailgate Meetings	Satisfactory
Comment	
Tailgate meetings are on file.	-
Sub-Contractor Meetings	Satisfactory
OSHA Permits	Satisfactory
Labor Law Postings	Satisfactory
Emergency / Other Postings	Satisfactory
First Aid / CPR Certification	Satisfactory
Emergency Items	
Access / Egress	Satisfactory
Elevator for Hoisting Workers (if needed)	Satisfactory
Comment	
Elevators are in place and operational.	-
Fire Extinguisher(s)	Satisfactory
First Aid Kit(s)	Satisfactory

Satisfactory

Satisfactory

Satisfactory

Satisfactory

N/A

_

Eye Wash Station	N/A
Other Fire Fighting Equipment (If needed)	N/A

General Items

Restrooms

Hand Washing Stations

Waste Containers

Comment Waste containers were in good order. Waste containers were in good order. Multiple were asked if water is accessible. All workers had water on had and near by.

Potable Water

Shade

Tools & Equipment	
Power Tools	Unsatisfactory
Comment	
J&S has a table saw that is missing the guard. The guard must be in place at all times. The worker noted he would add the guard.	
Hand Tools	Satisfactory
Powder Actuated Tools	Satisfactory

Pneumatic Nailers	Satisfactory
Comment	
Nail guns inspected had safety spring.	-
Mobile Elevated Work Plarforms (MEWP's)	Satisfactory
Powered Industrial Trucks	Satisfactory
Heavy Mobile Equipment (Excavators, Loaders, etc)	Satisfactory
Cranes	N/A
Cylinder Storage	Satisfactory
Ladders	Unsatisfactory
Comment	
Sharp workers have multiple ladders in use that are not opened fully. When the self supported ladder is in use the spreader bars must be opened and locked. The workers may need smaller ladders to fit in the corridor or move the materials so the ladders will fit. The workers complied to immediacy adjust the situation.	
Sharp workers have setup scaffold planks on an extension ladder. This scaffold platform is not supported by a manufactured scaffold frame, does not meet the minimum width on half of the platform and does not provide any fall protection with guard rails. Logan immediately addressed the situation with the workers who climbed down and were noted to use a scaffold from another level.	

Unsatisfactory

Sharp workers are placing planks on top of the self supported ladders in the stairwell. Scaffold platforms must be on manufactured scaffolding. Ladders may not be used to support scaffolds unless specified by the manufacturer and the guidelines are followed. The workers removed the planks. Please ensure they have the proper means to gain elevation.

Operations

Personal Protective Equipment

Comment

Multiple workers are observed missing required PPE in setting requiring hard hats. Pictured an Atlas worker doing over head work in a rough framing area while setting up to work off a ladder, does not have a hard hat. The worker donned his hard hat immediately.

Worker traversing the hallway does not have a hard hat. Please ensure when traversing the site all workers must have required PPE.

Trenching & Excavation

Fall Protection

Guardrails

Comment







Satisfactory

Satisfactory

Unsatisfactory

Floor / Wall Openings

falls are protected.


protection.


Please ensure two guard rails are erected where required. Here at the south east stairwell in the parking garage on the second (mezzanine) level, only one rail is posted. Guard rails must be erected at 42/21".

Comment

The stairwell opening is unprotected and must be covered or have

The door opening on the mezzanine level must have fall protection. In addition the scaffold that is greater than 16" from the structure (on the other side of the doorway) must have inside guard rails. Please ensure

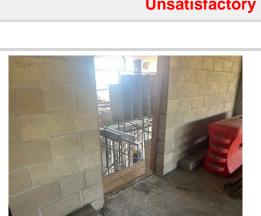

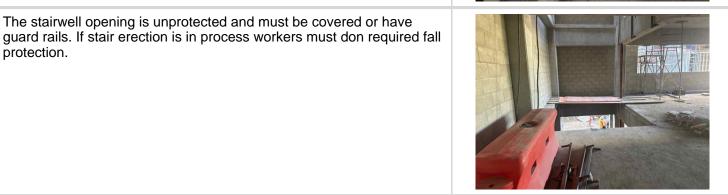


Supported Scaffolding Comment Triton has a scaffold that is missing an access ladder. A properly setup

access ladder must be in place to access working sections of the scaffold.



Unsatisfactory

Unsatisfactory

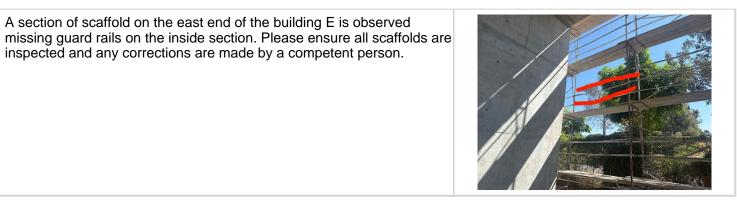

Mobile Scaffolding	Satisfactory
Suspended Scaffolding	N/A
Confined Spaces	N/A
Impalement Hazards	Satisfactory
Traffic Control	Satisfactory
Roofing Operations	Satisfactory
Housekeeping	Satisfactory
Comment	
Housekeeping is in good order.	-
Demolition	N/A
Silica Control	Satisfactory
Rigging Operations	Satisfactory
Hot Work	Satisfactory
Electrical Safety	Unsatisfactory
Comment	

N/A

There are several bulbs missing from light strings. Light strings must be inspected regularly to ensure all bulbs or manufactured caps are in place to eliminate any shock exposures.
Image: Comparison of the system of the s

Other Items (that were observed)