

# SAFETY INSPECTION REPORT

**CONDUCTED FOR:**  
Seaside Steel Inc.

**PROJECT:**  
Patterson BTS



**INSPECTION TYPE:**  
General Construction

**INSPECTOR :** BRITTON FIELD  
**DATE :** AUGUST 09, 2024  
**CITY :** PATTERSON  
**STATE :** CA

Safety Compliance Company is not responsible for unsafe conditions and situations not seen during this inspection. The items listed above represent only what was seen by the Safety Compliance Company Representative at the time of the inspection. Safety Compliance Company is not responsible for any ongoing unsafe condition(s) whether seen or unseen. In addition, Safety Compliance Company does not have the authority or authorization to approve, certify, or warranty any safety equipment or safety device. This agreement also indemnifies Safety Compliance Company of any omission, gross negligence, willful misconduct related to this report. Under Federal, State and Local Law, it is the responsibility of the employer and all subcontractors to mark all hazards with appropriate signs

# SUMMARY OF INSPECTION

<b>53</b> Items Inspected	<b>20</b> Satisfactory	<b>2</b> Unsatisfactory	<b>31</b> N/A
------------------------------	---------------------------	----------------------------	------------------

A safety inspection was carried out on site today. I was able to walk the site with James, and reviewed all safety concerns noticed on the spot.

(Today's projected High Temp: 100°)

James had all documentation and paperwork for the site filled out and kept on site. This includes:

- + Daily site inspections (digital)
- + Weekly tailgate meeting is being performed.
- + heat preparedness, and water replenishment forms.

At the time of the inspection the crew was tying footer, rebar on the inside east walls.

- + Plenty of cool drinking water was provided in coolers.
- + Restrooms were found in satisfactory condition with well stocked wash station.

Safety concerns addressed with James:

- One worker was reminded of the importance of wearing gloves when handling rebar or other sharp objects to avoid injuries to the hands. (James corrected on the spot.)
- It was recommended that the crew where hearing protection due to the decibel level in the area they were working in from the roofing work going on. The decibel level was consistently over 95 dB. (James obtained hearing protection from GVC)

Overall, the active work area was clear of debris.

- + No other safety hazards were observed at the time of inspection.

••• please see additional information below•••

# INSPECTION ITEMS

Documentation

Site Contact

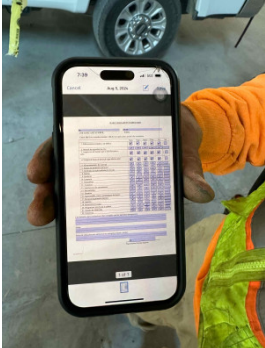
Satisfactory

<b>Comment</b>	
James was available to address all safety matters on the spot.	-

<b>Safety Program (Including IIPP)</b>	<b>Satisfactory</b>
<b>Comment</b>	
The IIPP / safety manual is located inside the foreman’s truck.	-

<b>Heat Illness Prevention Program</b>	<b>Satisfactory</b>
<b>Comment</b>	
Heat illness plan is in place. Water replenishment form is filled out and located inside of safety manual. (Today’s High Temp: 100° )	-

<b>Safety Data Sheets</b>	<b>N/A</b>
---------------------------	------------

<b>Daily Inspections</b>	<b>Satisfactory</b>
<b>Comment</b>	
Daily inspections are being performed and documented daily using the SCC app.	

<b>Tailgate Meetings</b>	<b>Satisfactory</b>
<b>Comment</b>	
Tailgates are being conducted at least every 10 working days	-

<b>Sub-Contractor Meetings</b>	<b>N/A</b>
--------------------------------	------------

<b>OSHA Permits</b>	<b>N/A</b>
---------------------	------------

<b>Labor Law Postings</b>	<b>Satisfactory</b>
<b>Comment</b>	

Labor law postings are located inside of site office of GVC.	-
--	---

<b>Emergency / Other Postings</b>	<b>Satisfactory</b>
-----------------------------------	---------------------

<b>Comment</b>	
----------------	--

Hospital / urgent care route map is located inside of safety manual.	-
--	---

<b>First Aid / CPR Certification</b>	<b>Satisfactory</b>
--------------------------------------	---------------------

<b>Comment</b>	
----------------	--

Foreman has CPR/first aid certification up-to-date.	-
---	---

<b>Emergency Items</b>	
------------------------	--

<b>Access / Egress</b>	<b>Satisfactory</b>
------------------------	---------------------

<b>Comment</b>	
----------------	--

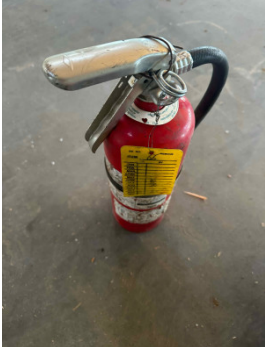
Site access is clear of obstructions.	-
---------------------------------------	---

<b>Elevator for Hoisting Workers (if needed)</b>	<b>N/A</b>
--	------------

<b>Fire Extinguisher(s)</b>	<b>Satisfactory</b>
-----------------------------	---------------------

<b>Comment</b>	
----------------	--

Charged fire extinguishers are located near the active work area.	-
---	---

Extinguishers are being inspected and documented monthly.	
---	---

<b>First Aid Kit(s)</b>	<b>Satisfactory</b>
-------------------------	---------------------

<b>Comment</b>	
----------------	--


First aid kit is located inside of foreman's truck. It is well stocked.	-
---	---

<b>Eye Wash Station</b>	<b>N/A</b>
-------------------------	------------

<b>Other Fire Fighting Equipment (If needed)</b>	<b>N/A</b>
--	------------

## General Items

<b>Restrooms</b>	<b>Satisfactory</b>
------------------	---------------------

<b>Comment</b>	
Restrooms were found in satisfactory condition near active work area.	


<b>Hand Washing Stations</b>	<b>Satisfactory</b>
------------------------------	---------------------

<b>Comment</b>	
Wash station was found in satisfactory condition. - Soap was available - Paper towels are stocked. - non-drinkable water sign was clearly visible	-

<b>Waste Containers</b>	<b>Satisfactory</b>
-------------------------	---------------------

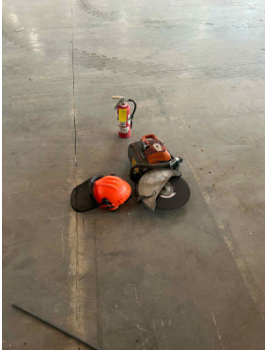
<b>Comment</b>	
Waste containers were located near restroom and active work area.	-

<b>Potable Water</b>	<b>Satisfactory</b>
----------------------	---------------------

<b>Comment</b>	
A 5 gallon thermoses of cool water are provided. Drinking cups, and trash bag is also located near the drinking station.	
Suggestion was given to safety, seal the water container, date, and time last replenished.	-

<b>Shade</b>	<b>Satisfactory</b>
<b>Comment</b>	
Permanent structure now provides adequate shade.	-

## Tools & Equipment

<b>Power Tools</b>	<b>Satisfactory</b>
<b>Comment</b>	
Power saw used for cutting rebar was found in satisfactory condition. Face shield and ear protection are provided.	

<b>Hand Tools</b>	<b>Satisfactory</b>
<b>Comment</b>	
No handed tools were observed in use at the time of inspection.	-

<b>Powder Actuated Tools</b>	<b>N/A</b>
------------------------------	------------

<b>Pneumatic Nailers</b>	<b>N/A</b>
--------------------------	------------

<b>Mobile Elevated Work Platforms (MEWP's)</b>	<b>N/A</b>
--	------------

<b>Powered Industrial Trucks</b>	<b>N/A</b>
<b>Comment</b>	
Reach lift was not being operated at the time of inspection.	-

<b>Heavy Mobile Equipment (Excavators, Loaders, etc)</b>	<b>N/A</b>
--	------------

<b>Cranes</b>	<b>N/A</b>
---------------	------------

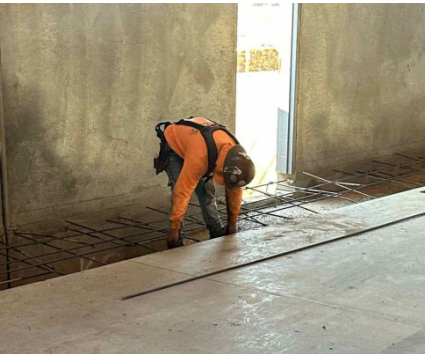
<b>Cylinder Storage</b>	<b>N/A</b>
-------------------------	------------

<b>Ladders</b>	<b>N/A</b>
----------------	------------

<b>Comment</b>	
No ladders were observed on site at the time of inspection.	-

## Operations

<b>Personal Protective Equipment</b>	<b>Unsatisfactory</b>
--------------------------------------	-----------------------

<b>Comment</b>	
One worker was reminded of the importance of wearing gloves when handling rebar or other sharp objects. (James corrected on the spot.)	

<b>Trenching &amp; Excavation</b>	<b>N/A</b>
-----------------------------------	------------

<b>Comment</b>	
No trenching or excavating was being performed near active work area.	-

<b>Fall Protection</b>	<b>N/A</b>
------------------------	------------

<b>Guardrails</b>	<b>N/A</b>
-------------------	------------

<b>Floor / Wall Openings</b>	<b>N/A</b>
------------------------------	------------

<b>Comment</b>	
No wall or floor openings were observed at the time of inspection.	-

<b>Supported Scaffolding</b>	<b>N/A</b>
------------------------------	------------

<b>Mobile Scaffolding</b>	<b>N/A</b>
---------------------------	------------

<b>Suspended Scaffolding</b>	<b>N/A</b>
------------------------------	------------

<b>Confined Spaces</b>	<b>N/A</b>
------------------------	------------

<b>Impalement Hazards</b>	<b>Satisfactory</b>
<b>Comment</b>	
No uncapped SSI impalement hazards were observed at the time of inspection.	-

<b>Traffic Control</b>	<b>N/A</b>
<b>Comment</b>	
Traffic control was as needed. (Buzz Oats)	-

<b>Roofing Operations</b>	<b>N/A</b>
---------------------------	------------

<b>Housekeeping</b>	<b>Satisfactory</b>
<b>Comment</b>	
Active work area was kept free of debris. Materials were stacked in a neat and organized manner.	-

<b>Demolition</b>	<b>N/A</b>
-------------------	------------

<b>Silica Control</b>	<b>N/A</b>
<b>Comment</b>	
No silica hazard work was being performed near active work area at the time of inspection.	-

<b>Rigging Operations</b>	<b>N/A</b>
<b>Comment</b>	
No rigging was being used at the time of inspection.	-

<b>Hot Work</b>	<b>N/A</b>
<b>Comment</b>	
No hot work (rebar cutting) was being done at the time of inspection.	-



<b>Electrical Safety</b>		<b>N/A</b>
<b>Comment</b>		
No electrical safety hazards were observed at the time of inspection.		-
<b>Lockout / Tagout</b>		<b>N/A</b>
<b>Stairways, Ramps, Runways</b>		<b>N/A</b>
<b>Other Items (that were observed)</b>		<b>Unsatisfactory</b>
<b>Comment</b>		
Recommendation was made to provide hearing protection due to the loud decibel level of the working environment. The active work area measured over 95 dB consistently. (James corrected on the spot)		-